

EXECUTIVE SUMMARY

Thank you for your continued hard work sampling **Pine Island Pond, Manchester** this year! Your monitoring group sampled the deep spot **three** times this year and has done so for many years. As you know, conducting multiple sampling events each year enables DES to more accurately detect water quality changes. Keep up the great work!

The New Hampshire Department of Environmental Services (DES), in conjunction with the U.S. Environmental Protection Agency (EPA) and the environmental consulting firm AECOM, conducted a Total Maximum Daily Load (TMDL) for total phosphorus for your pond. The TMDL refers to the pollutant reductions a waterbody needs to meet New Hampshire's water quality standards. Pine Island Pond was listed on the 2008 impaired waters [303(d)] list because elevated algal growth impaired the primary contact recreation (swimming) use. Phosphorus is the nutrient responsible for algal growth and is the pollutant to be reduced to control algal growth. DES is required by the Federal Clean Water Act (CWA), Section 303(d), to report every two years to the EPA on all waters not meeting state water quality standards.

The TMDL conducted at your pond identified an in-lake target phosphorus value that, when met, should result in no additional primary contact recreation impairments due to algal growth. A phosphorus budget was constructed, phosphorus sources identified and phosphorus reductions allocated to each of the sources to meet the target value. An implementation plan provides recommendations on watershed remediation activities to reduce phosphorus inputs to the pond.

The draft TMDL will be provided to your pond association, town, and watershed stakeholders for review and will also be available on the DES website at www.des.nh.gov/organization/divisions/water/wmb/tmdl/index.htm. There will be a period for public review and comment, anticipated for Summer 2009, where DES and/or AECOM will present it's findings to interested stakeholders. We anticipate a TMDL informational session in conjunction with the annual VLAP Workshop scheduled for May 16, 2009. We encourage your pond association and/or residents to attend the workshop to learn more about TMDLs in general and the TMDL for your pond. Phosphorus load reductions can only occur with the knowledge, participation and action of watershed residents, businesses and stakeholders. If you are interested in participating in an informational session at the VLAP Workshop please contact the VLAP Coordinator at sara.steiner@des.nh.gov or 603-271-2658. If you are interested in learning more about the TMDL Program, or attending additional informational sessions, please contact Peg Foss, TMDL Coordinator, at Margaret.foss@des.nh.gov or 603-271-5448.

OBSERVATIONS & RECOMMENDATIONS

DEEP SPOT

➤ **Chlorophyll-a**

Chlorophyll-a, a pigment found in plants, is an indicator of algal or cyanobacteria abundance. Algae are typically microscopic plants that are naturally found in the lake ecosystem. The measurement of chlorophyll-a in the water gives biologists an estimation of the algal concentration or lake productivity. Table 14 in Appendix A lists the current year chlorophyll-a data.

Figure 1 depicts the historical and current year chlorophyll-a concentration in the water column.

The median summer chlorophyll-a concentration for New Hampshire's lakes and ponds is 4.58 mg/m³.

The current year data (the top graph) show that the chlorophyll-a concentration **decreased slightly** from **June** to **July**, and then **decreased greatly** from **July** to **August**.

Please note that the June and July chlorophyll-a concentrations were **elevated**. Typically, chlorophyll-a concentrations above **15 mg/m³** are indicative of an algal bloom.

The historical data (the bottom graph) show that the **2008** chlorophyll-a mean is **greater than** the state and similar lake medians. For more information on the similar lake median, refer to Appendix D.

Overall, visual inspection of the historical data trend line (the bottom graph) shows a **variable** in-lake chlorophyll-a trend since monitoring began. Specifically the mean chlorophyll concentration has **fluctuated between approximately 2.90 and 21.98 mg/m³** since **2000**.

Please keep in mind that this trend is based on only **nine** years of data. After 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historical data to objectively determine if there has been a significant change in the annual mean transparency since monitoring began.

While algae are naturally present in all waterbodies, an excessive or increasing amount of any type is not welcomed. Phosphorus is the nutrient that algae typically depend upon for growth in New Hampshire lakes and ponds. Algal concentrations increase as nonpoint sources of phosphorus from the watershed increase, or as in-lake phosphorus sources increase. Increased Chlorophyll-a



2008

concentrations can also affect water clarity, causing Secchi-disk transparency to decrease (worsen) and turbidity to increase (worsen).

Therefore, it is extremely important for volunteer monitors to continually educate all watershed residents about management practices that can be implemented to minimize phosphorus loading to surface waters.

Pine Island Pond, Manchester

Figure 1. Monthly and Historical Chlorophyll-a Results

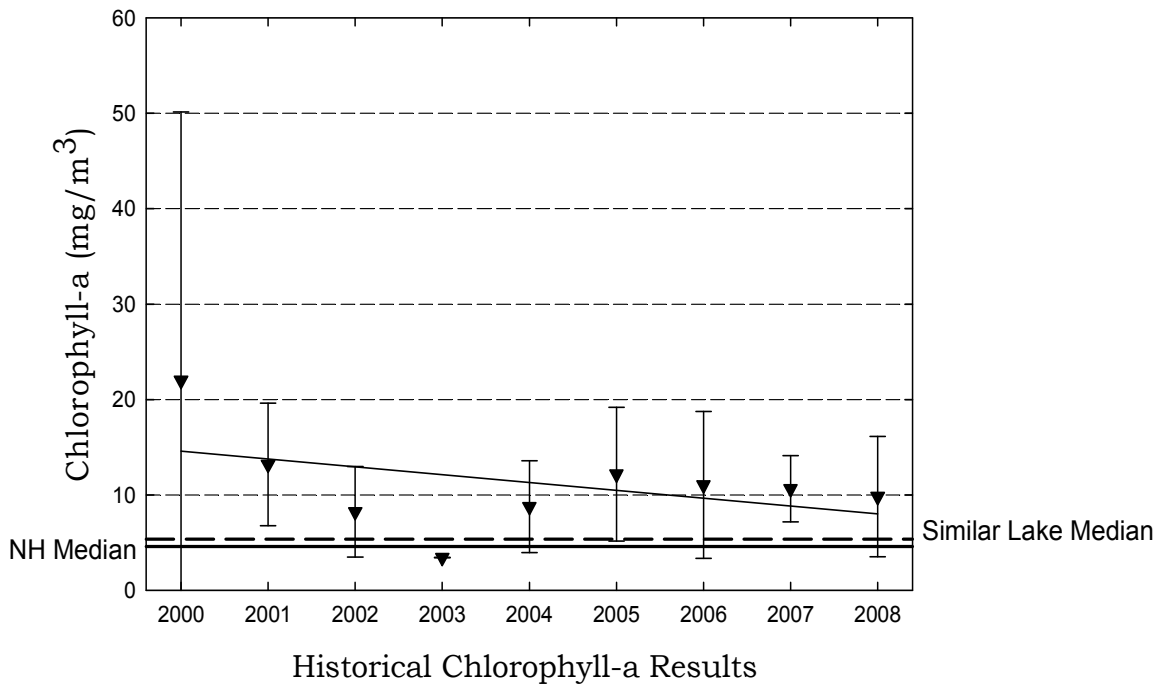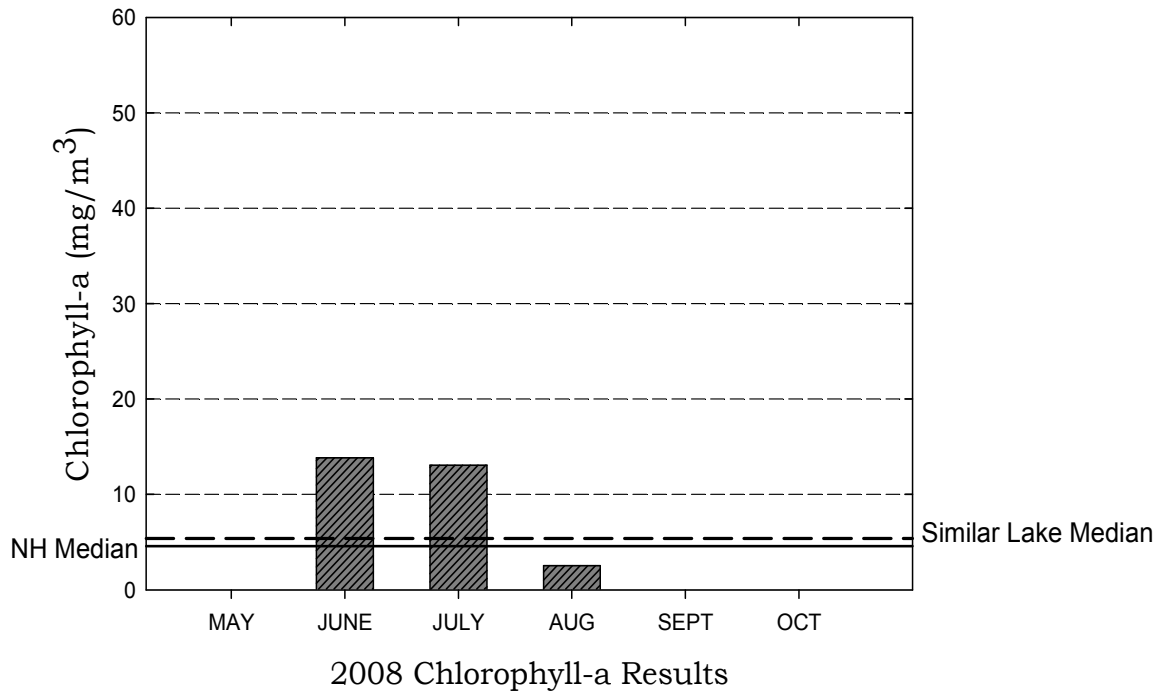

➤ **Phytoplankton and Cyanobacteria**

Table 1 lists the phytoplankton (algae) and/or cyanobacteria observed in the pond in **2008**. Specifically, this table lists the three most dominant phytoplankton and/or cyanobacteria observed and their relative dominance in the sample.

Table 1. Dominant Phytoplankton/Cyanobacteria (2008)

Sample Date	Division	Genus	% Dominance
6/25/2008	Chrysophyta	Synura	45.1
6/25/2008	Pyrrophyta	Ceratium	38.3
6/25/2008	Chrysophyta	Mallomonas	13.5
7/30/2008	Chrysophyta	Dinobryon	70.9
7/30/2008	Bacillariophyta	Unknown	9.4
7/30/2008	Chrysophyta	Synura	6.8

Phytoplankton populations undergo a natural succession during the growing season. Please refer to the “Biological Monitoring Parameters” section of this report for a more detailed explanation regarding seasonal plankton succession. Diatoms and golden-brown algae populations are typical in New Hampshire’s less productive lakes and ponds.

➤ **Secchi Disk Transparency**

Volunteer monitors use the Secchi disk, a 20 cm disk with alternating black and white quadrants, to measure how far a person can see into the water. Transparency, a measure of water clarity, can be affected by the amount of algae and sediment in the water, as well as the natural color of the water. Table 14 in Appendix A lists the current year transparency data. **The median summer transparency for New Hampshire’s lakes and ponds is 3.2 meters.**

Figure 2 depicts the historical and current year transparency *with and without* the use of a viewscope.

The current year *non-viewscope* in-lake transparency *decreased* from **June** to **July**, and then *increased* from **July** to **August**.

It is important to note that as the chlorophyll concentration *decreased* from **July** to **August**, the transparency *increased*. We typically expect this *inverse* relationship in lakes. As the amount of algal cells in the water *decreases*, the depth to which one can see into the water column typically *increases*, and vice-versa.

The transparency was not measured with the viewscope in 2008. We apologize for the inconvenience.

The historical data (the bottom graph) show that the **2008** mean non-viewscope transparency is ***less than*** the state and similar lake medians. Please refer to Appendix D for more information about the similar lake median.


Visual inspection of the historical data trend line (the bottom graph) shows a ***stable*** trend. Specifically, the transparency has ***remained relatively stable ranging between 1.80 and 2.70 meters*** since monitoring began in **2000**.

Please keep in mind that this trend is based on only ***nine*** years of data. After 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historical data to objectively determine if there has been a significant change in the annual mean transparency since monitoring began.


Typically, high intensity rainfall causes sediment-laden stormwater runoff to flow into surface waters, thus increasing turbidity and decreasing clarity. Efforts should continually be made to stabilize stream banks, pond shorelines, disturbed soils within the watershed, and especially dirt roads located immediately adjacent to the edge of tributaries and the pond. Guides to best management practices that can be implemented to reduce, and possibly even eliminate, nonpoint source pollutants, are available from DES upon request.

Pine Island Pond, Manchester

Figure 2. Monthly and Historical Transparency Results

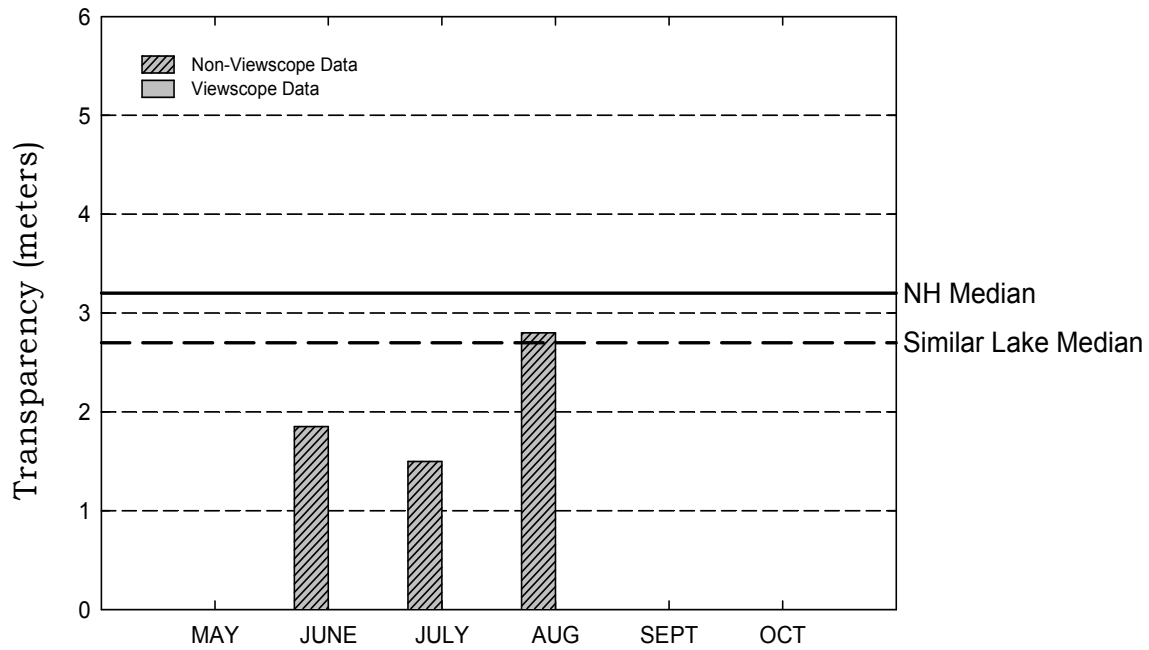

2008 Transparency Viewscope and Non-Viewscope Results

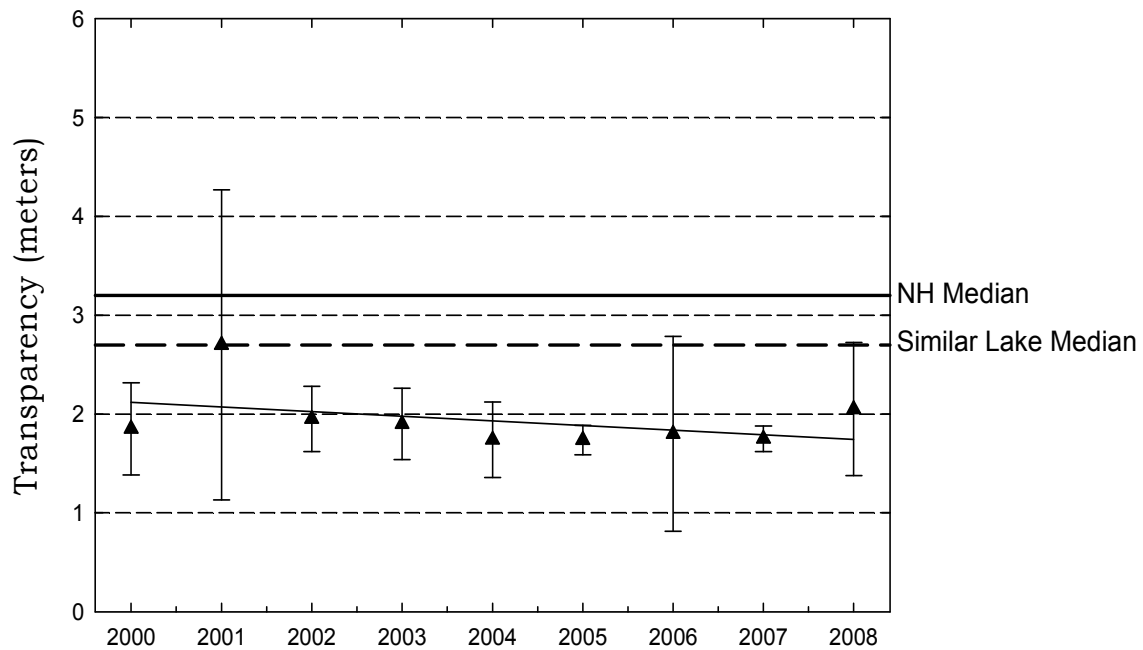

Historical Transparency Non-Viewscope Results

➤ **Total Phosphorus**

Phosphorus is typically the limiting nutrient for vascular plant and algae growth in New Hampshire's lakes and ponds. Excessive phosphorus in a pond can lead to increased plant and algal growth over time. Table 14 in Appendix A lists the current year total phosphorus data for in-lake and tributary stations. **The median summer total phosphorus concentration in the epilimnion (upper layer) of New Hampshire's lakes and ponds is 12 ug/L. The median summer phosphorus concentration in the hypolimnion (lower layer) is 14 ug/L.**

The graphs in Figure 3 depict the historical amount of epilimnetic (upper layer) and hypolimnetic (lower layer) total phosphorus concentrations; the inset graphs depict current year total phosphorus data.

The current year data for the epilimnion (the top inset graph) show that the phosphorus concentration **increased** from **June** to **July**, and then **decreased** from **July** to **August**.

The **elevated** epilimnetic phosphorus concentration measured on the **July** sampling event may have been due to phosphorus-enriched stormwater runoff that flowed into the surface layer of the pond. Field data indicate large amounts of rainfall were measured in the week prior to sampling.

The historical data show that the **2008** mean epilimnetic phosphorus concentration is **much greater than** the state and similar lake medians. Refer to Appendix D for more information about the similar lake median.

The current year data for the hypolimnion (the bottom inset graph) show that the phosphorus concentration **decreased** from **June** to **July**, and then **remained stable** from **July** to **August**.

The hypolimnetic (lower layer) turbidity samples were **elevated** on the **July** and **August** sampling events (**11.5, and 49 NTUs**). This suggests that the pond bottom may have been disturbed by the anchor or by the Kemmerer Bottle while sampling and/or that the pond bottom is **covered by an easily disturbed thick organic layer of sediment**. When the pond bottom is disturbed, phosphorus rich sediment is released into the water column. When collecting the hypolimnion sample, make sure that there is no sediment in the Kemmerer Bottle before filling the sample bottles.

The historical data show that the **2008** mean hypolimnetic phosphorus concentration is **much greater than** the state and similar lake medians. Please refer to Appendix D for more information about the similar lake median.

Overall, visual inspection of the historical data trend line for the epilimnion shows a **variable** phosphorus trend. Specifically, the mean annual epilimnetic

phosphorus concentration has ***fluctuated between approximately 15.8 and 52.7 ug/L*** since monitoring began in **2000**.



Overall, visual inspection of the historical data trend line for the hypolimnion shows an ***increasing*** phosphorus trend since monitoring began. Specifically the mean annual concentration has ***worsened*** since monitoring began in **2000**.

As discussed previously, after 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historical data to objectively determine if there has been a significant change in the annual mean phosphorus concentration since monitoring began.

One of the most important approaches to reducing phosphorus loading to a waterbody is to continually educate watershed residents about the watershed sources of phosphorus and how excessive phosphorus loading can negatively affect the ecology and the recreational, economical, and ecological value of lakes and ponds.

Pine Island Pond, Manchester

Figure 3. Monthly and Historical Total Phosphorus Data

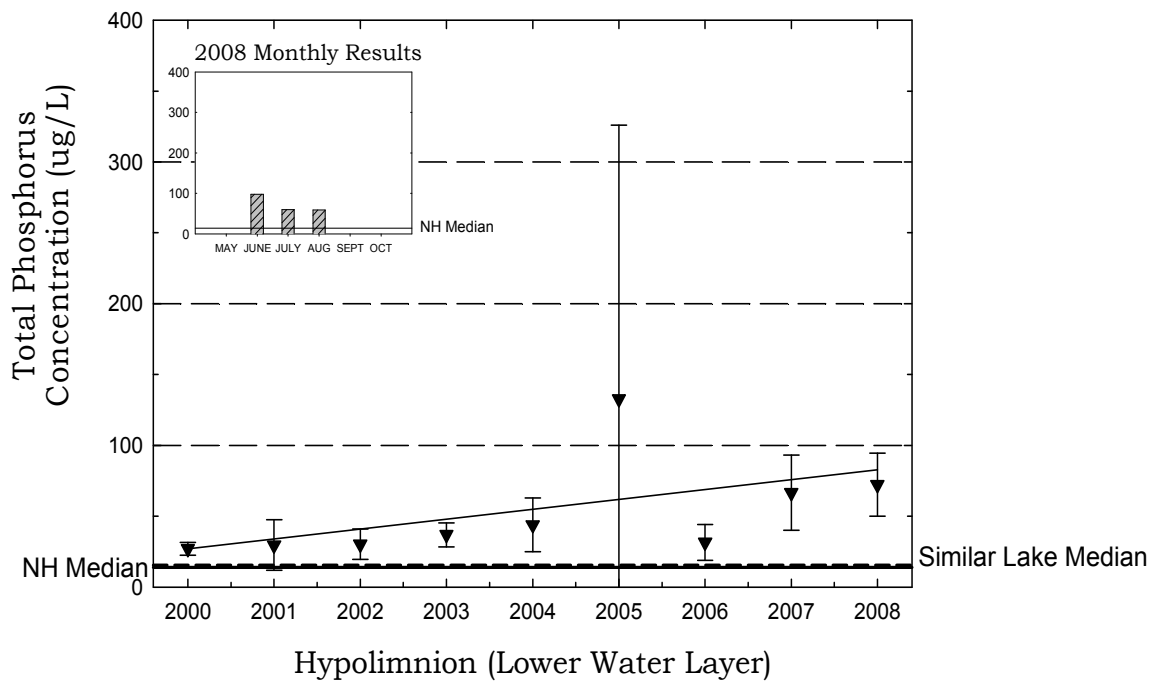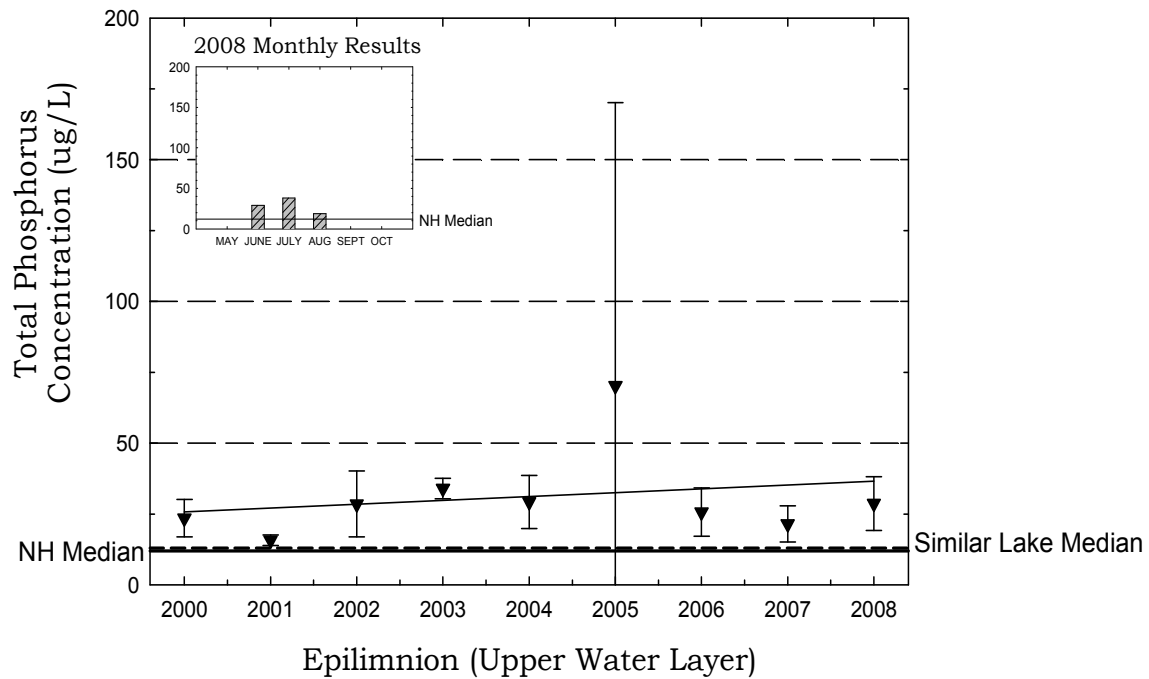

➤ pH

Table 14 in Appendix A presents the current year pH data for the in-lake stations.

pH is measured on a logarithmic scale of 0 (acidic) to 14 (basic). pH is important to the survival and reproduction of fish and other aquatic life. A pH below 6.0 typically limits the growth and reproduction of fish. A pH between 6.0 and 7.0 is ideal for fish. The median pH value for the epilimnion (upper layer) in New Hampshire's lakes and ponds is **6.6**, which indicates that the state surface waters are slightly acidic. For a more detailed explanation regarding pH, please refer to the "Chemical Monitoring Parameters" section of this report.

The pH at the deep spot this year ranged from **6.63 to 6.83** in the epilimnion and from **6.26 to 6.49** in the hypolimnion, which means that the water is ***slightly acidic***.

It is important to point out that the hypolimnetic (lower layer) pH was ***lower (more acidic)*** than in the epilimnion (upper layer). This increase in acidity near the bottom is likely due to the decomposition of organic matter and the release of acidic by-products into the water column.

Due to the state's abundance of granite bedrock and acid deposition received from snowmelt, rainfall, and atmospheric particulates, there is little that can be feasibly done to effectively increase pond pH. The pH at the deep spot, however, is sufficient to support aquatic life.

➤ Acid Neutralizing Capacity (ANC)

Table 14 in Appendix A presents the current year epilimnetic ANC for the deep spot.

Buffering capacity (ANC) describes the ability of a solution to resist changes in pH by neutralizing the acidic input. The median ANC value for New Hampshire's lakes and ponds is **4.9 mg/L**, which indicates that many lakes and ponds in the state are at least "moderately vulnerable" to acidic inputs. For a more detailed explanation about ANC, please refer to the "Chemical Monitoring Parameters" section of this report.

The acid neutralizing capacity (ANC) of the epilimnion (upper layer) ranged from **15.6 mg/L to 24.7 mg/L**. This indicates that the pond has a ***low vulnerability*** to acidic inputs.

➤ Conductivity

Table 14 in Appendix A presents the current conductivity data for in-lake stations.

Conductivity is the numerical expression of the ability of water to carry an electric current, which is determined by the number of negatively charged ions from metals, salts, and minerals in the water column. The median conductivity value for New Hampshire's lakes and ponds is **40.0 uMhos/cm**. For a more detailed explanation, please refer to the "Chemical Monitoring Parameters" section of this report.

The in-lake conductivity continued to remain ***much greater than*** the state median. Typically, increasing conductivity indicates the influence of pollutant sources associated with human activities. These sources include failed or marginally functioning septic systems, agricultural runoff, and road runoff which contains road salt during the spring snow-melt. New development in the watershed can alter runoff patterns and expose new soil and bedrock areas, which could also contribute to increasing conductivity. In addition, natural sources, such as iron and manganese deposits in bedrock, can influence conductivity.

We recommend that your monitoring group conduct a shoreline conductivity survey of the pond and tributaries with ***elevated*** conductivity to help identify the sources of conductivity.

To learn how to conduct a shoreline or tributary conductivity survey, please refer to the 2004 special topic article, which is posted on the VLAP website at <http://www.des.nh.gov/organization/divisions/water/wmb/vlap/categories/publications.htm>, or contact the VLAP Coordinator.

It is likely that de-icing materials applied to nearby roadways during the winter months may be influencing the conductivity in the pond. In New Hampshire, the most commonly used de-icing material is salt (sodium chloride).

Therefore, we recommend that the **epilimnion** (upper layer) be sampled for chloride next year. This additional sampling may help us identify what areas of the watershed are contributing to the increasing in-lake conductivity.

Please note that the DES Limnology Center in Concord is able to conduct chloride analyses, free of charge. As a reminder, it is best to conduct chloride sampling in the spring as the snow is melting and during rain events.

➤ Dissolved Oxygen and Temperature

Table 9 in Appendix A depicts the dissolved oxygen/temperature profile(s) collected during **2008**.

The presence of sufficient amounts of dissolved oxygen in the water column is

vital to fish and amphibians and also to bottom-dwelling organisms. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation.

During this year, and many past sampling years, the pond has experienced a lower dissolved oxygen concentration and higher total phosphorus concentration in the hypolimnion (lower layer) than in the epilimnion (upper layer). These data suggest that the process of **internal phosphorus loading** is occurring in the pond. When the hypolimnetic dissolved oxygen concentration is depleted to less than 1 mg/L, **as it was on the annual biologist visit this year and on many previous annual visits**, the phosphorus that is normally bound up with metals in the sediment may be re-released into the water column. Since an internal source of phosphorus in the pond may be present, it is even more important that watershed residents act proactively to minimize phosphorus loading from the watershed.

➤ **Turbidity**

Table 14 in Appendix A presents the current year data for in-lake turbidity.

Turbidity in the water is caused by suspended matter, such as clay, silt, and algae. Water clarity is strongly influenced by turbidity. Please refer to the “Other Monitoring Parameters” section of this report for a more detailed explanation.

The turbidity of the epilimnion (upper layer) sample was **slightly elevated (2.41 and 3.19 NTUs)** on the **June** and **July** sampling events. The abnormally wet conditions this summer likely led to increased stormwater runoff entering the pond. Stormwater runoff can carry particulate matter and deposits it in the pond causing turbid conditions. Or, an algal bloom had occurred in the lake.

The turbidity of the metalimnion (middle layer) sample was **slightly elevated (3.32 and 3.88 NTUs)** on the **June** and **July** sampling events. The chlorophyll-a concentrations were also elevated during this time. This suggests that a layer of algae may have been present at this location. Algae are often found in the metalimnion of ponds due to the differences in density between the epilimnion and the hypolimnion and the resulting abundance of food in that layer.

As discussed previously, the hypolimnetic (lower layer) turbidity was **elevated (11.5 and 49 NTUs)** on the **July** and **August** sampling events. In addition, the hypolimnetic turbidity has been elevated on many sampling events during previous sampling years. This suggests that the pond bottom may have been disturbed by the anchor or by the Kemmerer Bottle while sampling and/or that the lake bottom is covered by an easily disturbed thick organic layer of sediment. When the pond bottom is disturbed, phosphorus rich sediment is released into the water column. When collecting the hypolimnion sample, make sure that there is no sediment in the Kemmerer Bottle before filling the sample bottles.

TRIBUTARY SAMPLING

➤ **Total Phosphorus**

Table 14 in Appendix A presents the current year total phosphorus data for tributary stations. Please refer to the “Chemical Monitoring Parameters” section of the report for a detailed explanation of total phosphorus.

The phosphorus concentration in the **Inlet** sample on the **June** and **July** sampling events was ***elevated (28 and 31 ug/L)***, and the turbidity was also ***slightly elevated (2.20 and 2.51 NTUs)***.

The phosphorus concentration in the **Outlet** sample on the **July** sampling events was ***elevated (39 ug/L)***, and the turbidity was also ***slightly elevated (3.21 NTUs)***.

Elevated turbidity levels are most often a result of sediment and/or organic material present in the sample. These materials typically contain attached phosphorus and when present in elevated amounts contribute to elevated tributary phosphorus levels. Also, field data indicate significant storm events prior to sample collection, which likely contributed sediment-laden stormwater to the tributaries.

➤ **pH**

Table 14 in Appendix A presents the current year pH data for the tributary stations. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation of pH.

The pH of the tributary stations ranged from **6.54 to 7.16 (> 6)** and is sufficient to support aquatic life.

➤ **Conductivity**

Table 14 in Appendix A presents the current conductivity data for the tributary stations. Please refer to the “Chemical Monitoring Parameters” section of the report for a more detailed explanation of conductivity.

The tributaries have experienced elevated conductivity levels since monitoring began. We recommend that your monitoring group conduct a conductivity survey of tributaries with ***elevated*** conductivity and along the shoreline of the pond to help identify the sources of conductivity. As previously mentioned increasing conductivity typically indicates the influence of pollutant sources associated with human activities.

We recommend that your monitoring group conduct stream surveys and rain

event sampling along the tributaries with **elevated** conductivity so that we can determine potential sources to the lake.

For a detailed explanation on how to conduct rain event sampling and stream surveys, please refer to the 2002 VLAP Annual Report special topic article, which is posted on the VLAP website at

<http://www.des.nh.gov/organization/divisions/water/wmb/vlap/categories/publications.htm>, or contact the VLAP Coordinator.

➤ **Turbidity**

Table 14 in Appendix A presents the current year turbidity data for the tributary stations. Please refer to the “Other Monitoring Parameters” section of the report for a more detailed explanation of turbidity.

The **Inlet** and **Outlet** experienced turbid conditions in **June** and **July**, likely the result of stormwater runoff from significant rain events prior to sampling. Rainfall creates runoff that washes sediment and organic materials into tributaries causing turbid water conditions. Eventually, the suspended solids settle out once the flow is reduced or the tributary flow enters the lake.

➤ **Bacteria (*E. coli*)**

Table 14 in Appendix A lists the current year data for bacteria (*E.coli*) testing. *E. coli* is a normal bacterium found in the large intestine of humans and other warm-blooded animals. *E.coli* is used as an indicator organism because it is easily cultured and its presence in the water, in defined amounts, indicates that sewage **may** be present. If sewage is present in the water, potentially harmful disease-causing organisms **may** also be present. Please refer to the “Other Monitoring Parameters” section of the report for a more detailed explanation.

Bacteria sampling was not conducted this year. If residents are concerned about sources of bacteria such as failing septic systems, animal waste, or waterfowl waste, it is best to conduct *E. coli* testing when the water table is high, when beach use is heavy, or immediately after rain events.

➤ **Chlorides**

Table 14 in Appendix A lists the current year data for chloride sampling. The chloride ion (Cl⁻) is found naturally in some surface waters and groundwaters and in high concentrations in seawater. Research has shown that elevated chloride levels can be toxic to freshwater aquatic life. In order to protect freshwater aquatic life in New Hampshire, the state has adopted **acute and chronic** chloride criteria of **860 and 230 mg/L** respectively. The chloride content in New Hampshire lakes is naturally low, generally less than 2 mg/L in surface waters located in remote areas away from habitation. Higher values are

generally associated with salted highways and, to a lesser extent, with septic inputs. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation.

Chloride sampling was **not** conducted during **2008**.

DATA QUALITY ASSURANCE AND CONTROL

Annual Assessment Audit:

During the annual visit to your pond, the biologist conducted a sampling procedures assessment audit for your monitoring group. Specifically, the biologist observed the performance of your monitoring group while sampling and filled-out an assessment audit sheet to document the volunteer monitors’ ability to follow the proper field sampling procedures, as outlined in the V LAP Monitor’s Field Manual. This assessment is used to identify any aspects of sample collection in which volunteer monitors failed to follow proper procedures, and also provides an opportunity for the biologist to retrain the volunteer monitors as necessary. This will ultimately ensure that the samples volunteer monitors collect are truly representative of actual lake and tributary conditions.

Overall, your monitoring group did an **excellent** job collecting samples on the annual biologist visit this year! Specifically, the members of your monitoring group followed the proper field sampling procedures and there was no need for the biologist to provide additional training. Keep up the good work!

Sample Receipt Checklist

Each time your monitoring group dropped off samples at the laboratory this summer, the laboratory staff completed a sample receipt checklist to assess and document if your group followed proper sampling techniques when collecting the samples. The purpose of the sample receipt checklist is to minimize, and hopefully eliminate, improper sampling techniques.

Overall, the sample receipt checklist showed that your monitoring group did a **very good** job when collecting samples this year! Specifically, the members of your monitoring group followed the majority of the proper field sampling procedures when collecting and submitting samples to the laboratory. However, the laboratory did identify a few aspects of sample collection that your group could improve upon, as follows:

- **Deep Spot Sampling:** Sediment and or organic debris was observed in the white sample bottle for the **Hypolimnion** on the **July** sampling event. Please check the Kemmerer bottle for sediment prior to filling the sample bottles. If sediment is observed in the Kemmerer bottle, please collect another sample. You may have to wait for sediment to settle out of the hypolimnion or sample at a slightly different depth to obtain a clean sample.

USEFUL RESOURCES

Best Management Practices to Control Nonpoint Source Pollution: A Guide for Citizens and Town Officials, DES Booklet WD-03-42, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/publications/wd/documents/wd-03-42.pdf.

Erosion Control for Construction in the Protected Shoreland Buffer Zone, DES fact sheet WD-SP-1, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/sp/documents/sp-1.pdf.

Impacts of Development Upon Stormwater Runoff, DES fact sheet WD-WQE-7, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/aot/documents/wqe-7.pdf.

Lake Protection Tips: Some Do's and Don'ts for Maintaining Healthy Lakes, DES fact sheet WD-BB-9, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/bb/documents/bb-9.pdf.

Proper Lawn Care In the Protected Shoreland, The Comprehensive Shoreland Protection Act, DES fact sheet WD-SP-2, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/sp/documents/sp-2.pdf.

Road Salt and Water Quality, DES fact sheet WD-WMB-4, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/wmb/documents/wmb-4.pdf.

Shorelands Under the Jurisdiction of the Comprehensive Shoreland Protection Act, DES fact sheet SP-4, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/sp/documents/sp-4.pdf.